



Fräsmesser aus Werkzeugstahl (Fortsetzung)*


(alle Maße in mm)

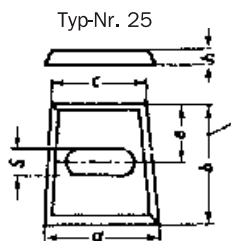


Typ-Nr. 26 (735.092-095)

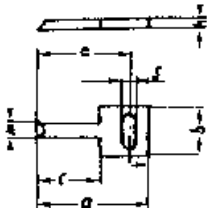


Typ-Nr. 26 (735.103-111)

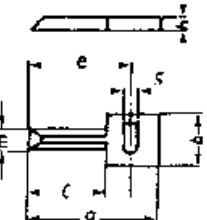


Typ-Nr. 27

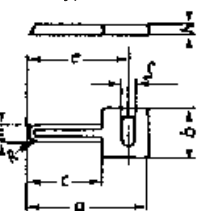


Typ-Nr. 28

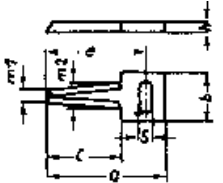

Typ-Nr. 28a

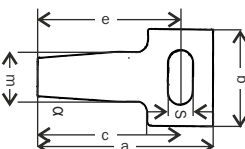

Typ-Nr. 29

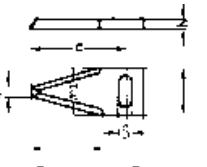

6.) FLACHMESSER, scharf

Bestell-Nr.	Messer Nr.	S	a	b	c	e	h
735.073	FZ07.1101	9	37	85	30	44	6
735.079	FZ07.1103	17	70	85	60	40	8
735.083	FZ07.1105	17	150	85	140	40	8

7.) FINGERMESSER, scharf

Bestell-Nr.	Messer Nr.	S	a	b	c	e	h	m
735.092	26.006	9	47	24	25	37	5	6
735.095	26.009	9	57	24	35	47	6	9

735.103	26.024	17	105	40	65	85	7	24
735.106	26.030	17	110	40	70	90	7	30
735.107	26.032	17	115	46	75	95	7	32
735.108	26.034	17	115	46	75	95	7	34
735.108A	FZ07.1505	17	120	50	80	100	10	35
735.109	26.036	17	120	46	80	100	7	36
735.110	26.038	17	125	46	85	105	7	38
735.111	26.040	17	125	46	85	105	7	40

8.) FINGERMESSER, halbrund

Bestell-Nr.	Messer Nr.	S	a	b	c	e	h	m	R
735.122	27.004	9	57	24	35	47	5	8	4
735.123	27.005	9	67	24	45	57	6	10	5
735.125A	FZ07.1602	13	85	40	50	65	5	15	7,5
735.126	27.008	13	85	30	55	70	7	16	8
735.127	27.009	13	90	30	60	75	7	18	9
735.128	27.010	13	90	30	60	75	7	20	10
735.129	27.011	17	105	40	65	85	7	22	11
735.130	27.012	17	105	40	65	85	7	24	12
735.131	27.013	17	110	40	70	90	7	26	13
735.132	27.014	17	110	40	70	90	7	28	14
735.133	27.015	17	110	40	70	90	7	30	15

9.) FINGERMESSER, konisch

Bestell-Nr.	Messer Nr.	S	a	b	c	e	h	m1	m2
735.143	28.003	17	105	40	65	85	7	15	22
735.144	28.004	17	105	40	65	85	7	20	30
735.145	28.005	17	105	40	65	85	7	25	30
735.147	FZ07.1802	17	100	50	60	115	10	35	50

9a.) FINGERMESSER, gerade konisch

Bestell-Nr.	Messer Nr.	S	a	b	c	e	h	m	α
735.140	FZ07.1700	17	100	60	60	80	10	30/26	3°/5°
735.140A	FZ07.1701	17	110	60	70	90	10	30/23	3°/5°

10.) FINGERMESSER, stark konisch

Bestell-Nr.	Messer Nr.	S	a	b	c	e	h	m1	m2
735.151	29.001	9	58	24	36	48	5	6	24
735.152	29.002	13	75	30	45	60	6	10	30
735.153	29.003	17	105	40	65	85	7	15	50

* Die Artikelreihe läuft aus. Lieferbar, solange Vorrat reicht!

Bemerkung:

Die Schlitzbreiten bzw. der Lochdurchmesser der Fräsmesser weisen auf die erforderlichen Fräsdorne und besonders auf den Spanschraubendurchmesser hin.